

**NOTES:**

1. REPAIRS TO THE TOP SURFACE OF THE CONCRETE SHALL BE PERFORMED IN ACCORDANCE WITH THE SPECIAL PROVISION FOR "PARTIAL DEPTH PATCH".
2. EXISTING BITUMINOUS CONCRETE NORTH OF THE EXPANSION JOINT BETWEEN COLUMN LINES 21 & 22 SHALL BE REMOVED AND REPLACED WITH BITUMINOUS CONCRETE, CLASS 2. REMOVAL OF BITUMINOUS PAVEMENT SHALL BE PAID FOR UNDER "REMOVAL OF BITUMINOUS TYPE PAVEMENT." PAVING TO BE PAID FOR UNDER "BITUMINOUS CONCRETE, CLASS 2." PAVEMENT MARKINGS TO BE PAINTED TO MATCH EXISTING. PAID FOR UNDER "PAINTED PAVEMENT MARKINGS 4" WHITE." (INCLUDED IN ADD ALTERNATE #1)
3. BITUMINOUS CONCRETE SOUTH OF EXPANSION JOINT SHALL BE PATCHED AS DIRECTED BY THE ENGINEER. WORK TO BE PAID FOR UNDER "LOCALIZED PAVEMENT REPAIR." THIS ITEM SHALL INCLUDE SAWCUTTING AND REMOVAL OF EXISTING BITUMINOUS PAVEMENT, AND PLACEMENT OF NEW TACK COAT AND BITUMINOUS PAVEMENT. (INCLUDED IN ADD ALTERNATE #1)
4. ALL FAILED CONNECTIONS OF THE METAL BEAM RAIL TO THE CONCRETE COLUMN SHALL BE REPAIRED. DRILL AND GROUT NEW ANCHOR BOLTS INTO THE CONCRETE COLUMNS AT THE EAST FASCIA, MATCH EXISTING BOLT SIZE. ANCHOR BOLTS SHALL BE HILTI HVA OR APPROVED EQUAL. WORK TO BE PAID FOR UNDER "REPAIR METAL BEAM RAIL CONNECTION" AND SHALL BE PAID AT THE UNIT COST EACH COLUMN LOCATION.
5. CONTRACTOR SHALL LOCATE ALL ACTIVE SCUPPERS AND DOWNSPOUTS AND REMOVE DEBRIS TO ALLOW FOR PROPER DRAINAGE. WORK TO BE PAID FOR UNDER "CLEAN DRAINAGE SYSTEM."
6. FASTEN LOOSE SECTION OF EXTRUSION TO DECK OR ADJACENT EXTRUSION SECTIONS. CONTRACTOR SHALL SUBMIT PROPOSED METHOD OF FASTENING TO ENGINEER FOR REVIEW/APPROVAL. WORK TO BE PAID FOR UNDER "REPAIR EXPANSION JOINT."

**LEGEND:**

- Ⓧ(# PICKETS) REPAIR MISSING PICKETS IN RAILING (PAID FOR UNDER "REPAIR PEDESTRIAN RAIL")
- AREA OF PROPOSED PAVEMENT REMOVAL AND REPLACEMENT (ADD ALTERNATE #1)
- AREA OF REPRESENTATIVE PAVEMENT PATCHING (LOCATIONS TO BE SPECIFIED BY THE ENGINEER) (ADD ALTERNATE #1)

PLAN - UPPER DECK  
N.T.S.




**ADDENDUM #1**

REV.	DATE	DESCRIPTION	REVISIONS	SHEET. NO.
Δ	6/23/14	ADDENDUM #1 - REVISED SIDEWALK SURFACE REPAIR LIMITS	2A	

MANUAL REVISIONS TO THIS DOCUMENT ARE PROHIBITED. ALL REVISIONS MUST BE DONE TO ELECTRONIC MEDIA.

SCALE AS NOTED

DESIGNER: M. HABEK  
 DRAFTER: M. HABEK  
 CHECKED BY: S. DRECHSLER  
 DATE CHECKED:

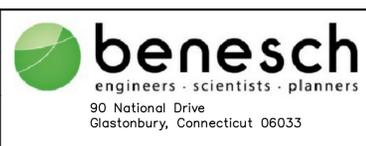

PROJECT TITLE:  
**ARCADE PARKING GARAGE IMPROVEMENTS**

CADD PLOTTED: 5/5/2014

TOWN: MIDDLETOWN, CONNECTICUT

DRAWING TITLE:  
**GENERAL PLAN UPPER LEVEL**

BID NO.: 2014-016  
 DRAWING NO.: S-2A  
 SHEET NO.: 2A